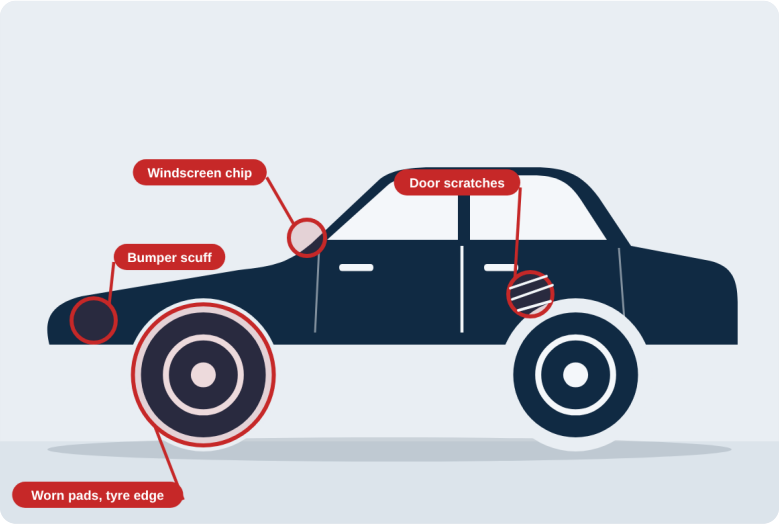


2016 Toyota Camry

XLE · Silver · Sedan

VIN / chassis
JTNB11HK4G3000123

Odometer
128,450 km

Category
tokunbo

Region
Lagos

Inspected
2026-11-10

Seller
Sample Motors (illustrative)

Vehicle ID
CQV-8K3M2P

CONDITION: CHASSIQ SCORE

4 / 5

★★★★☆

Very good

MARKET VALUE: CHASSIQ VALUE

₦10,600,000

Range ₦9,900,000 to ₦11,400,000

Confidence 78/100 (Medium)

Estimated market value

FOR LENDERS

Financing accepted value
₦10,200,000


Forced-sale value
₦8,300,000

Seller asks ₦11,200,000


In short

- 49 of 60 checked items are in good order, 3 show normal wear.
- 8 items need attention: 1 major, 7 minor. Photos are on the following pages.
- No flood, fire, structural-repair, odometer or other history warnings were recorded.
- Grade limits applied: At least one major defect (max 4 stars).
- Road test completed; service history partial; spare key present.


Exterior at a glance

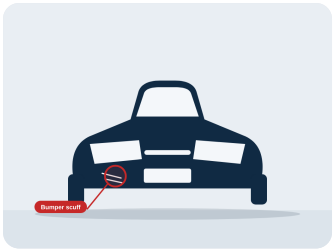

Front

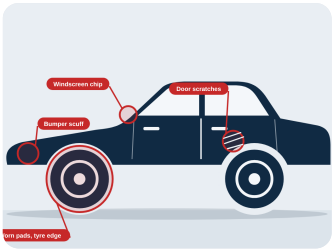

Left side

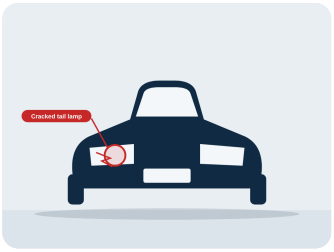

Rear


Right side

OK · Normal wear · Minor defect · Major defect · Critical · Not applicable · Not inspected


Condition by area

Each area is scored out of 100. Its weight shows how much it counts towards the overall grade.

Structure & chassis	weight 15	**100**
Engine	weight 18	**95.56**
Transmission & drivetrain	weight 12	**100**
Suspension & steering	weight 10	**100**
Brakes	weight 9	**92**
Body & paint	weight 10	**73.08**
Tyres & wheels	weight 5	**86.43**
Electrical & electronics	weight 8	**97.69**
Interior	weight 7	**97**
A/C & climate	weight 6	**100**

Items needing attention (8)


Worst first. Photos show the fault found by the inspector.

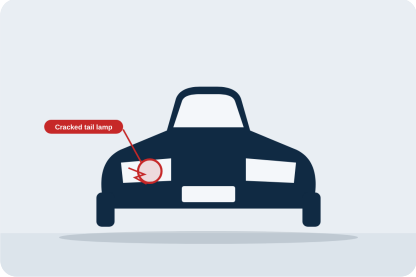

MAJOR DEFECT — Body & paint

Lights and lenses

Rear left tail lamp lens is cracked. Water can get in; replace the lamp.

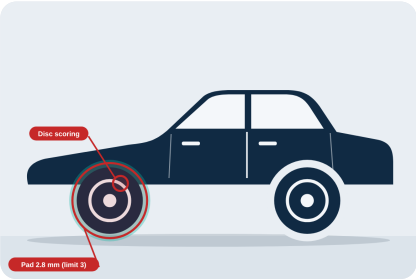


MINOR DEFECT — Brakes

Pads and discs

Measured: 2.8

Front pads are worn close to the limit and the discs show light scoring. Replace pads and skim or replace discs soon.

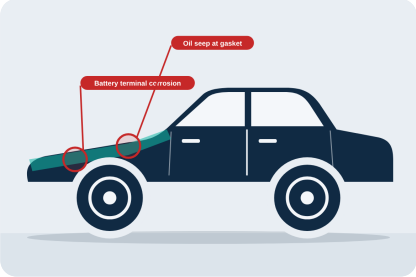


MINOR DEFECT — Engine

Oil leaks

Light oil seep at the valve cover gasket. No drips on the ground. Monitor and reseal at next service.

OK · Normal wear · Minor defect · Major defect · Critical · Not applicable · Not inspected

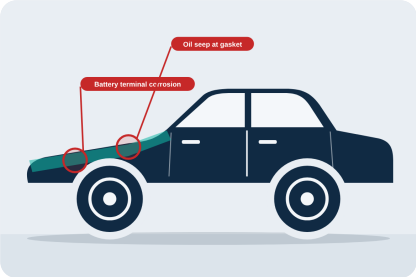


MINOR DEFECT

Electrical & electronics

Battery and charging

Measured: 12.3

Battery terminals show light white corrosion. Battery voltage is acceptable at 12.3 V. Clean the terminals.

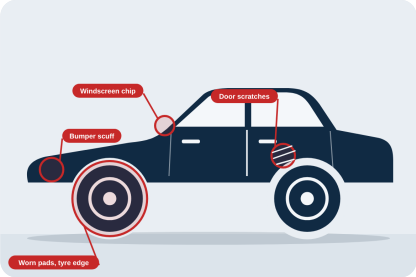


MINOR DEFECT

Body & paint

Scratches

Three light scratches on the rear left door, through the clear coat. Polishing will not remove all of them.

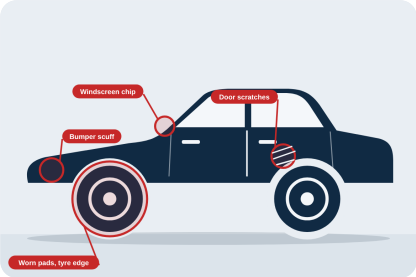


MINOR DEFECT

Body & paint

Glass and windscreen

Stone chip in the lower left of the windscreen, outside the driver’s view. Repair before it spreads.

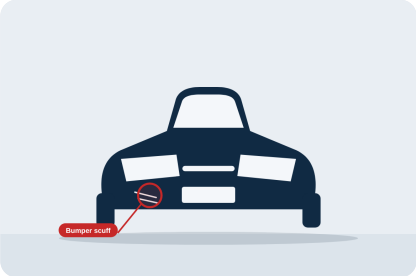


MINOR DEFECT

Body & paint

Bumpers

Scuffs on the front bumper corner from a low-speed knock. Bumper is not cracked.

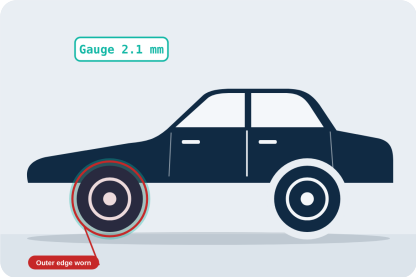

MINOR DEFECT

Tyres & wheels

Tread depth (lowest tyre)

Measured: 2.1

Front left tyre is worn on the outer edge: tread 2.1 mm at the lowest point. Check alignment and replace the tyre.

Also noted

Normal wear and items that could not be checked.


- **Normal wear** — Seats and upholstery: Wear on the driver seat bolster and a small mark on the cushion, consistent with age and use.

OK · Normal wear · Minor defect · Major defect · Critical · Not applicable · Not inspected


- **Normal wear** Dents: Small shallow dent on the rear left door, no paint damage.
- **Normal wear** Tyre age (DOT code): Tyres are 4 years old (DOT code).

Photo gallery


10 photos taken by the inspector on site.

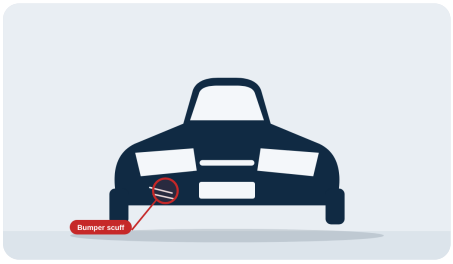

Front

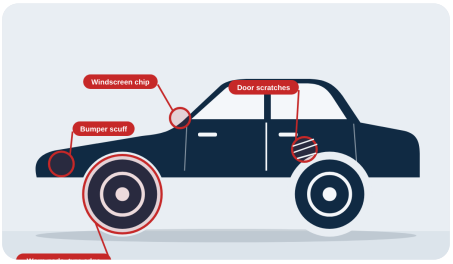


Left side

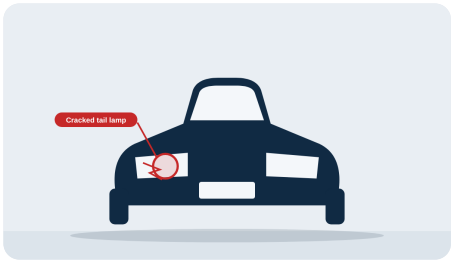


Rear



Right side

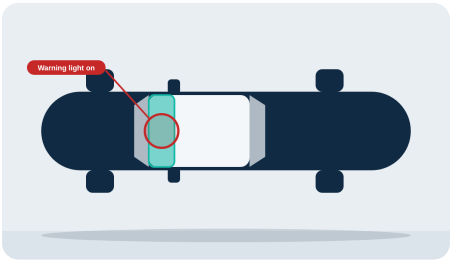


Dashboard, ignition on

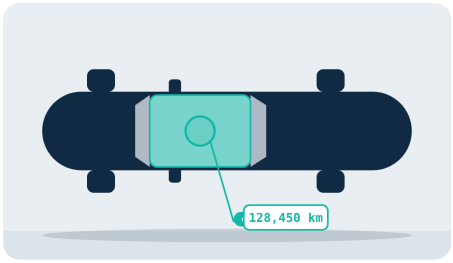


Odometer close-up

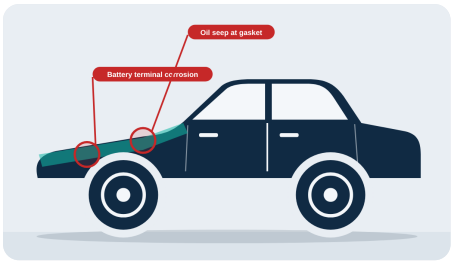


Engine bay, bonnet open

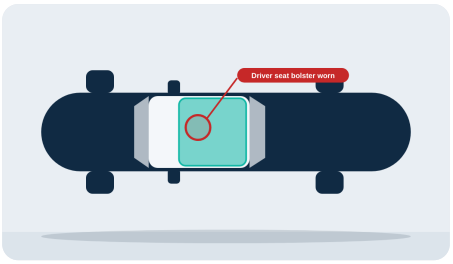

Front seats

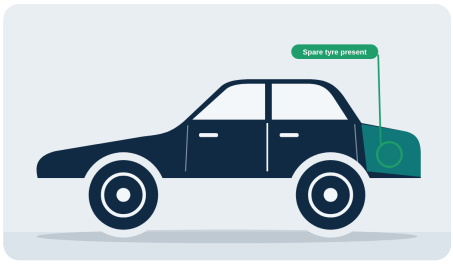

Boot with spare well open

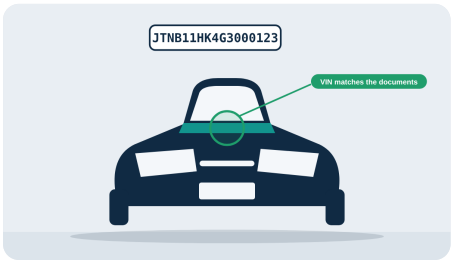

VIN plate or label (close-up)

Identity and history checks

VIN typed by inspector	**JTNB11HK4G3000123**
VIN read at	**dashboard: JTNB11HK4G3000123 · door jamb: JTNB11HK4G3000123**
Engine number	**2AR-FE 5127734**
Customs / import papers	**customs papers_seen**
History warnings	**none recorded**
Converted or facelifted body	**—**

OK · Normal wear · Minor defect · Major defect · Critical · Not applicable · Not inspected

How the market value was worked out

ChassiQ Value compared this vehicle with 6 recent sales and listings, adjusting each for age, mileage, condition and region, and weighting them by how recent, reliable and similar they are. The estimate is ₦10,600,000, with a likely range of ₦9,900,000 to ₦11,400,000. Confidence is 78 out of 100 (Medium). Lenders finance against the lower of the agreed price and the estimated market value. Valid until undefined. Engine undefined. Values are estimates, not guarantees of a sale price.

How to read this report

- OK: In good working order
- Minor defect: Small fault. Photo and note needed
- Critical: Safety or structural fault. 2 photos and note
- Not inspected: Could not be checked. Give the reason
- Normal wear: Age-related wear, no action needed
- Major defect: Needs repair. Photo and note needed
- Not applicable: This vehicle does not have it

Verify this report: scan the code or open https://chassiq.example/verify/CQ-2026-000125

Report CQ-2026-000125 · Inspection INS-2026-LA-000125
This report reflects a physical inspection by a ChassiQ field officer on the date shown. The photos and checks are held on file.